# CTP343 Catphan® Low Contrast Phantom Manual

Copyright © 2018

#### WARRANTY

THE PHANTOM LABORATORY INCORPORATED ("Seller") warrants that this product shall remain in good working order and free of all material defects for a period of one (1) year following the date of purchase. If, prior to the expiration of the one (1) year warranty period, the product becomes defective, Buyer shall return the product to the Seller at:

By Truck By Mail

The Phantom Laboratory, Incorporated The Phantom Laboratory, Incorporated

2727 State Route 29 PO Box 511

Greenwich, NY 12834 Salem, NY 12865-0511

Seller shall, at Seller's sole option, repair or replace the defective product. The Warranty does not cover damage to the product resulting from accident or misuse.

IF THE PRODUCT IS NOT IN GOOD WORKING ORDER AS WARRANTED, THE SOLE AND EXCLUSIVE REMEDY SHALL BE REPAIR OR REPLACEMENT, AT SELLER'S OPTION. IN NO EVENT SHALL SELLER BE LIABLE FOR ANY DAMAGES IN EXCESS OF THE PURCHASE PRICE OF THE PRODUCT. THIS LIMITATION APPLIES TO DAMAGES OF ANY KIND, INCLUDING, BUT NOT LIMITED TO, DIRECT OR INDIRECT DAMAGES, LOST PROFITS, OR OTHER SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER FOR BREACH OF CONTRACT, TORT OR OTHERWISE, OR WHETHER ARISING OUT OF THE USE OF OR INABILITY TO USE THE PRODUCT. ALL OTHER EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANT ABILITY AND FITNESS FOR PARTICULAR PURPOSE, ARE HEREBY DISCLAIMED.

### **WARNING**

This product has an FH3-4 mm/min flame rating and is considered to be flammable. It is advised not to expose this product to open flame or high temperature (over 125° Celsius or 250° Fahrenheit) heating elements.

# The Phantom Laboratory

# Catphan® 343 Phantom Manual

Contents

Warranty 1

Indications for use 4

Introduction 4

Schematic drawing 5

Scanning alignment 6

CTP344 Low contrast module 7

### **Indications for Use**

The Catphan® 343 is designed for evaluation of low contrast performance in CT scanners.

### Introduction


The Phantom Laboratory, Incorporated developed the Catphan® 343 phantom with the CTP344 low contrast module to measure low contrast sensitivity.

The phantom contains 3 sets of low contrast rods that are described in this manual.

If you have questions about this or other Catphan phantoms please contact The Phantom Laboratory at the following address:

The Phantom Laboratory, Incorporated PO Box 511, Salem NY 12865 USA Phone: 800-525-1190 or 518-692-1190


Fax: 518-692-3329

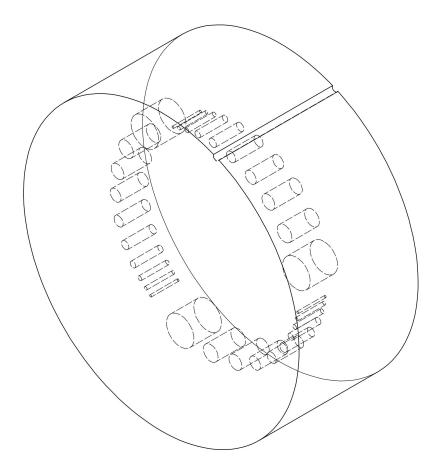


CTP344 Low Contrast Module

# Catphan® 343 Drawing

The Catphan® 343 Phantom contains the CTP344 low contrast module along with the CTP486-5 uniformity module.

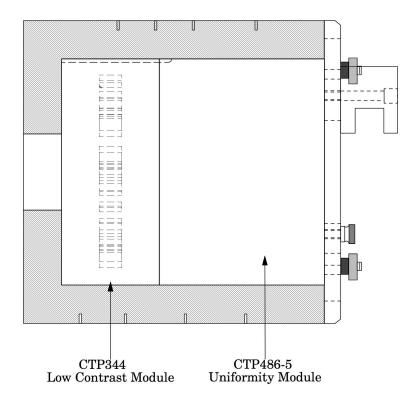


## Scanning alignment

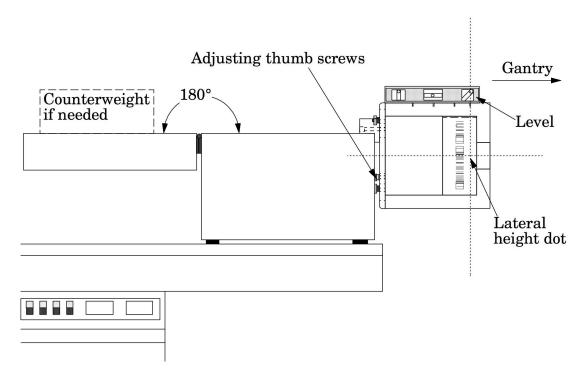

The Catphan® 343 Phantom comes with a Catphan® case and mount. By mounting the phantom on the case it can be cantilevered off the edge of the table eliminating table artifacts. Adjusting thumb screws enables the phantom to be leveled.

### CTP344 low contrast module

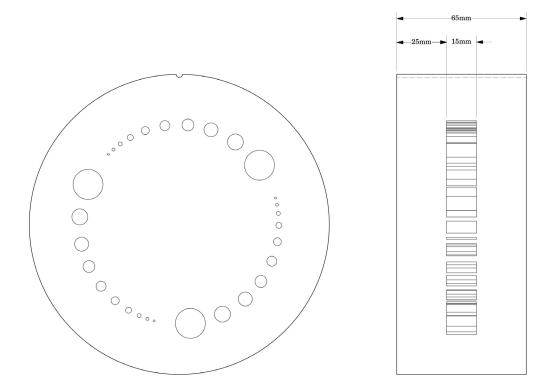

The low contrast targets have the following diameters and contrasts:

Target diameters

1.0mm

1.5mm

2.0mm

 $3.0 \mathrm{mm}$ 

4.0mm

5.0mm

 $6.0 \mathrm{mm}$ 

7.0mm

8.0mm

15.0mm

Nominal target contrast levels:  $0.3\%~(\pm .05\%)$  All of the targets in the 3 contrast target arrays are cast from a single mix

Since the target contrasts are nominal, the actual target contrasts need to be determined before testing specific contrast performance specifications. The actual contrast levels are measured by making region of interest measurements over the larger target, and in the local background area. To determine actual contrast levels, average the measurements made from several scans.

It is important to measure the background area adjacent to the measured target because "cupping" and "capping" effects cause variation of CT numbers from one scan region to another. Position the region of interest to avoid the target edges. The region of interest should be at least 4 x 4 pixels in diameter. Because low contrast measurements are "noisy", it is advisable to calculate the average of the multiple measurements made from several scans. Carefully monitor the mAs setting and the presence of any dose-modulation and or dose reducing methods being used, because

the photon flux will improve with increased x-ray exposure. The size of the targets visualized under various noise levels can be used to estimate information on contrast detail curves. that the contrast levels will be the same for all targets.

The equation below can be used in conjunction with other published models of target detection in CT, to convert the measured contrasts and diameters to other estimated specified contrasts and diameters.

(Measured Contrast) \* (smallest diameter discernible) = Constant

example: 0.3% contrast \* 3mm diameter @ 0.5% = 1.5